

# Installation Instructions

## OnTrac Cable Tray

### Safety Information

**WARNING:**

DO NOT USE AS A WALKWAY, LADDER, OR SUPPORT FOR PERSONNEL.  
USE ONLY AS A MECHANICAL SUPPORT FOR CABLES, TUBING AND RACEWAY.

### Intended Use

Install this tray only in a restricted service environment, such as a data center. Use indoors only, in environmentally controlled areas; do not use outdoors, or in harsh environments. Allow only qualified service personnel to install or use this tray.

### Tools Required


- Cable Tray Cutting Tool (P/N 34839-001)
- 7/16" Socket Wrench
- Sand Paper (for removal of painted finish)

### Recommended Tools:


- Any tools needed for mounting the tray should be identified before installation.
- A metal file may be used to chamfer rough edges after cutting tray.
- Handheld rotary sanding tools speed up paint removal.
- Marking tools for marking wire cut locations reduce mistakes and ease planning.
- Electric nut drivers reduce assembly time of fittings.
- A plumb bob or laser level may be used to verify effectiveness of mounting points.
- A level may be used to check consistency of tray runs.
- A vacuum may be useful for cleanup of metal and paint shavings.

### Cutting Recommendations


- Use cable tray cutting tool P/N 34839-001 to cut tray wires. Use side action bolt cutter to prevent sharp wires from protruding past the cut intersection.
- Angle cuts beyond cross wire (See Offset Cut image below).
- Concentrate on making smooth, clean cuts to prevent sharp edges.
- Cut bottom wires first, in the order shown below, starting the first cut at ① and continuing in numerical order (see Bottom Cutting Order image).
- Cut side wires next, starting at the top and working down (see Side Cutting Order image).
- Examine all cuts and smooth out any sharp edges.

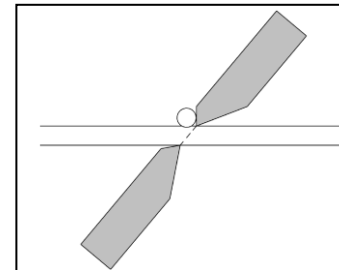


**Offset Cut  
(Recommended)**

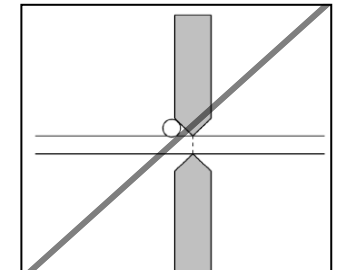

**Center Cut Blades are  
NOT Recommended**

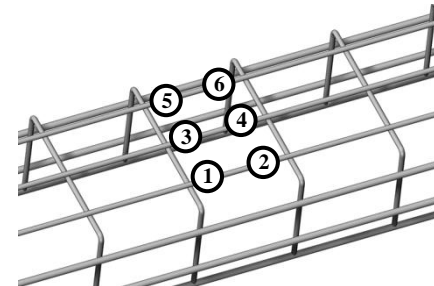

**Bottom Cutting Order**

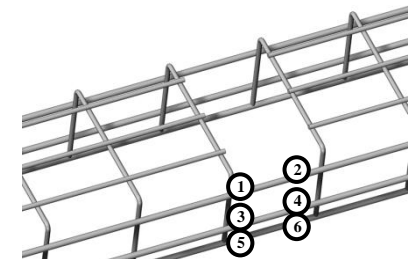

**Side Cutting Order**



**CHATSWORTH PRODUCTS, INC.**

IIS-734811, 05/07/12, Rev. 4, CPI/JJY/JLN

800-834-4969 (USA & Canada) • [www.chatsworth.com](http://www.chatsworth.com) • [techsupport@chatsworth.com](mailto:techsupport@chatsworth.com)

For international phone numbers, see our website or contact CPI Tech Support.

*This drawing contains proprietary and confidential information and is protected by U.S. and international law. Unauthorized reproduction, disclosure or use of the drawing or the information therein is expressly forbidden except as agreed to in writing by Chatsworth Products, Inc.*


# Installation Instructions

## OnTrac Cable Tray


### End-to-End Splicing OPTION 1

- Use Standard Splice Kit (P/N 34738-X01) to connect sections of wire mesh cable tray together end-to-end, at intersections and turns
- Refer to table below for the number of splices required to form an end-to-end connection. Standard Splices Kits are sold in packs of 50 splices. Quantities listed in table are for individual splices.
- Use two splices (one per side) on the sides of the 2"H (50 mm) tray and four splices (two per side) on the sides of the 4"H (100 mm) and 6"H (150 mm) trays; use the rest of the splices evenly spaced on the bottom of the tray.
- The two halves of the splice wrap around adjacent wires on the tray connecting the tray wires together.
- Always install bolt heads on the inside of the tray to protect cables.
- Electrical bonding of painted trays and connectors requires metal-to-metal contact between tray wires and the splice. Remove paint where the splices contact the trays.
- Cable tray employing these splice methods is suitable for use as an equipment grounding conductor.

**P/N 34738-X01: Standard Splice**

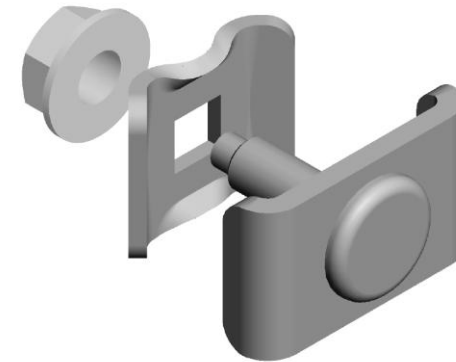

Number of Standard Splices Required to Form an End-to-End Connection								
Tray Height	Tray Width							
	4" 100 mm	6" 150 mm	8" 200 mm	12" 300 mm	16" 400 mm	18" 450 mm	20" 500 mm	24" 600 mm
2" 50 mm	2	4	4	4	4	4	5	5
4" 100 mm	4	5	6	6	7	7	7	8
6" 150 mm	N/A	N/A	6	6	7	7	7	8

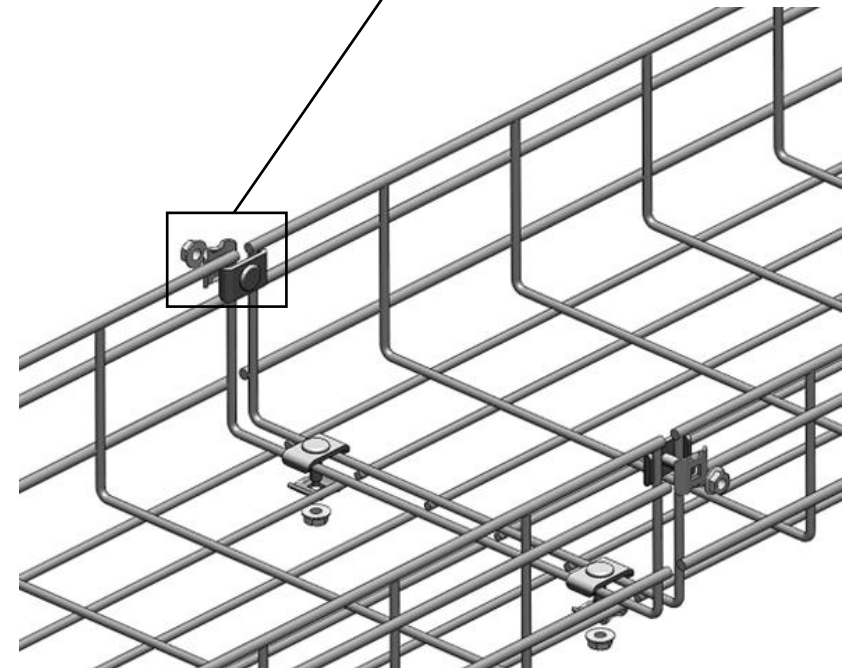

# Installation Instructions

## OnTrac Cable Tray


### End-to-End Splicing OPTION 2

- Use OPTION 2 with Standard OnTrac Wire Mesh Cable Tray only (P/Ns 34811-XXX, 34821-XXX, 34831-XXX).
- Use Spring Splice Kit (P/N 34834-X01) to connect sections of wire mesh cable tray together end-to-end.
- Refer to table below for the number of splices required to form an end-to-end connection. Spring Splice Kits are sold in packs of 50 splices. Quantities listed in table are for individual splices.
- Use two splices (one per side) on the sides of the 2"H (50 mm) tray and up to four splices (two per side) on the sides of the 4"H (100 mm) and 6"H (150 mm) trays; use the rest of the splices evenly spaced on the bottom of the tray.
- The splice wraps around adjacent wires on the tray connecting the tray wires together.
- Insert splice as shown and use installation tool to pull splice into place.
- Ensure that the splice is installed with the middle tab facing in the tray and the flat edges are facing away from the tray.
- The tray will not be stable until splices are installed on both sides of the tray.
- Electrical bonding of painted trays and connectors requires metal-to-metal contact between tray wires and the splice. Remove paint anywhere the splices contact the trays.
- Cable tray employing these splice methods is suitable for use as an equipment grounding conductor.


**Number of Spring Splices Required to Form an End-to-End Connection**

Tray Height	Tray Width							
	4"	6"	8"	12"	16"	18"	20"	24"
100 mm	150 mm	200 mm	300 mm	400 mm	450 mm	500 mm	600 mm	
2" 50 mm	2	2	2	2	2	4	4	4
4" 100 mm	2	2	2	4	4	6	6	6
6" 150 mm	N/A	N/A	4	4	6	6	7	7


### STEP 1: Insert Splice

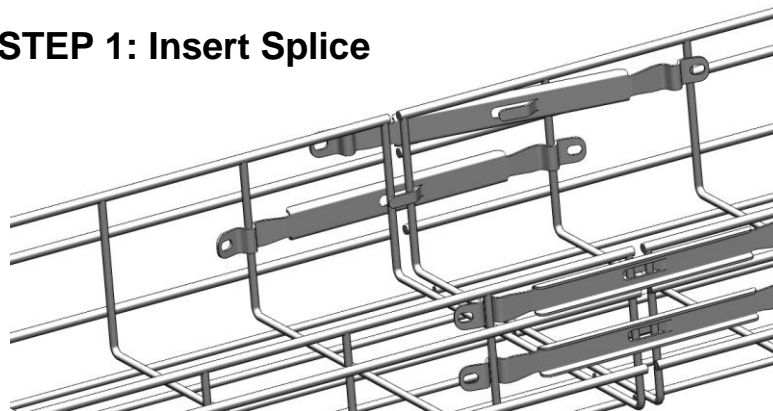

### STEP 2: Align Tool

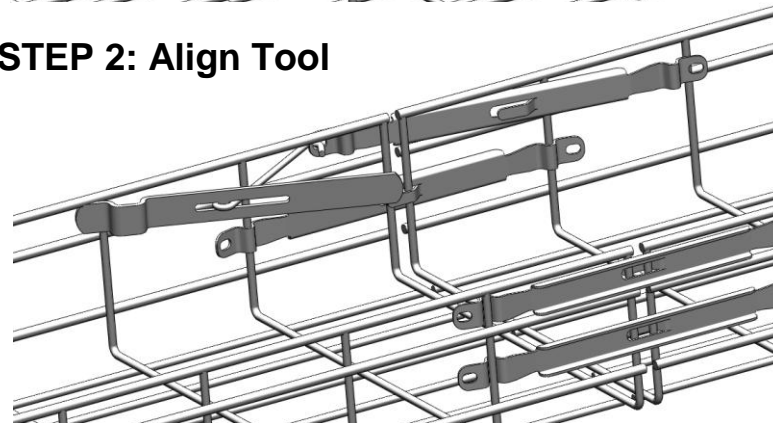

### STEP 3: Lock splice into place

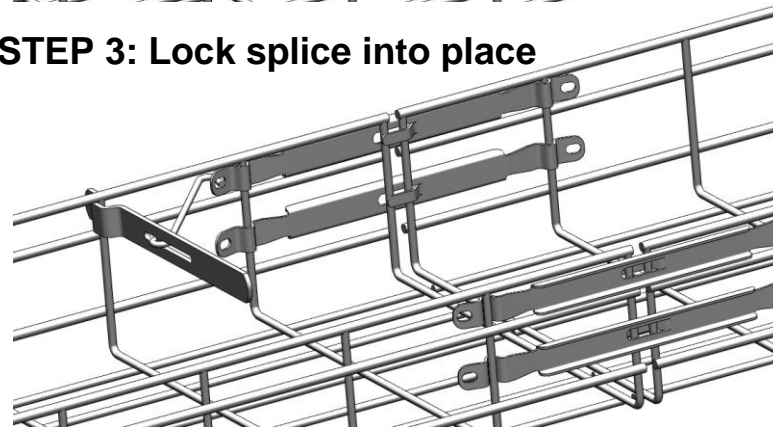




# Installation Instructions

## OnTrac Cable Tray

### End-to-End Splicing OPTION 3

- Recommended for all trays that are 18"W (450 mm) or wider
- Use Splice Bar (P/N 34739-X01) with Standard Splice Kits (P/N 34738-X01) to create a more secure end-to-end connection between wire mesh cable tray sections. Splice Bars replace Standard Splices used on side of tray.
- Refer to table below for the number of Splice Bars required to form an end-to-end connection. Splice Bars are sold in packs of 50. Quantities listed in table are for individual splices.
- Use two splice bars (one per side) on the sides of the 2"H (50 mm) tray and four splice bars (two per side) on the sides of the 4"H (100 mm) and 6"H (150 mm) trays.
- Splice Bar attaches to the side of the tray using three Splice Washer & Bolts (P/N 34728-X01); 1/4" hardware
- Always install bolt heads on the inside of the tray to protect cables.
- Electrical bonding of painted trays and connectors requires metal-to-metal contact between tray wires and the splices. Remove paint where the splices contact the trays and splice bars.
- Cable tray employing these splice methods is suitable for use as an equipment grounding conductor.

P/N 34728-X01:  
Splice Washer & Bolt

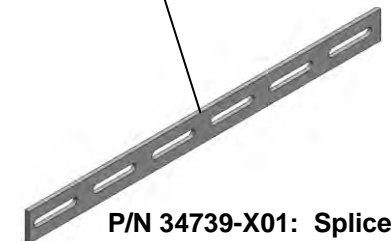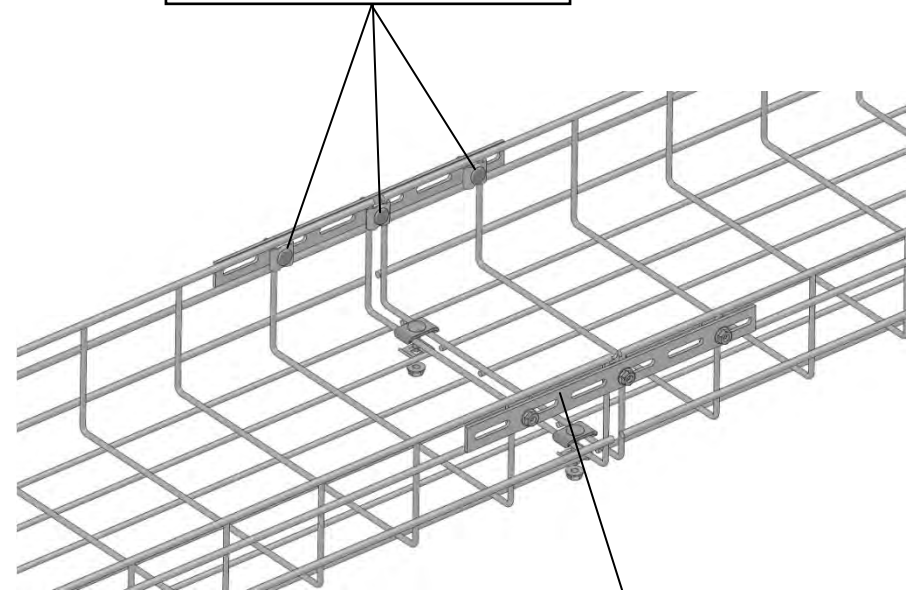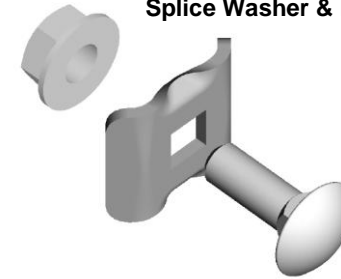

P/N 34739-X01: Splice Bar

Number of Splice Bars Required for an End-to-End Connection

Tray Height	Tray Width				
	12" 300 mm	16" 400 mm	18" 450 mm	20" 500 mm	24" 600 mm
2" 50 mm	2	2	2	2	2
4" 100 mm	4	4	4	4	4
6" 150 mm	4	4	4	4	4

# Installation Instructions

## OnTrac Cable Tray


### Smooth 90° Turn

- Refer to the table below to determine how many tray sections will be required to be cut from the tray for the turn (See images on right for detail).
- Refer to table below for the number of hardware pieces required to form a smooth 90° turn. Splice Kit, Splice Bar and Splice Washer & Bolt Kit are sold in packs of 50. Quantities listed in this table are for individual splices/bars/washers.
- Make one splice connection between each removed section. One connection is made using a Splice Bar (P/N 34739-X01) and two Splice Washers & Bolts (P/N 34728-X01). The Splice Bar may be cut short with wire cutters for finished look. The rest of the connections use Standard Splices (P/N 34738-X01).
- Always install bolt heads on the inside of the tray to protect cables.
- Electrical bonding of painted trays and connectors requires metal-to-metal contact between tray wires and the splice. Remove paint where the splices contact the trays.
- Installing a ground conductor along fitting using P/N 34838-001 is required to insure bonding across removed sections (See page 8 for details).
- Cable tray employing these splice methods is suitable for use as an equipment grounding conductor.

**Smooth 90° Turn Forming Guide**

Tray Width	Removed Sections	Standard Splice Bolt P/N 34738-X01	Splice Bar P/N 34739-X01	Splice Washer and Bolt P/N 34728-X01
4" 100 mm	2	1	1	2
6" 150 mm	3	2	1	2
8" 200 mm	4	3	1	2
12" 300 mm	6	5	1	2
16" 400 mm	7	6	1	2
18" 450 mm	8	7	1	2
20" 500 mm	10	9	1	2
24" 600 mm	11	10	1	2

**2"H x 12"W tray before bend**

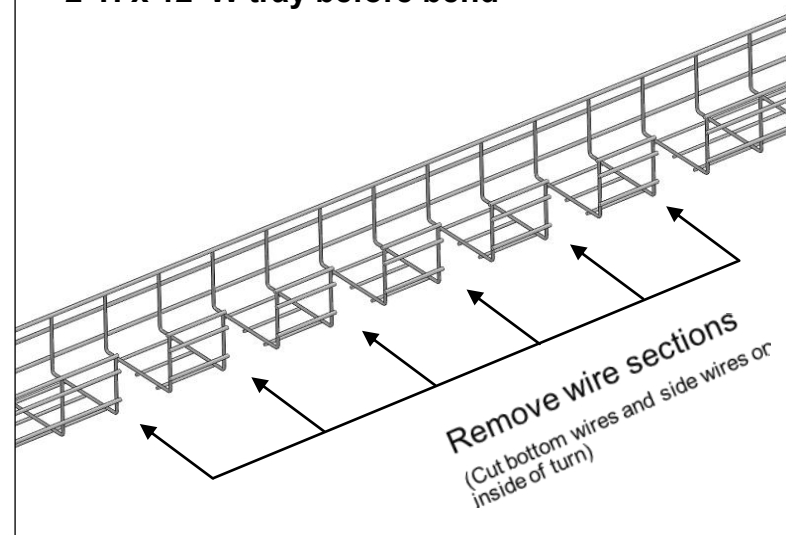


# Installation Instructions

## OnTrac Cable Tray

### Tight 90° Turn

- Refer to the table to the right to determine how many tray sections will be required to be cut from the tray for the turn. Insure that the side wire cuts and the mid-section cuts are always symmetric (See cutting detail on the next page).
- Bend the tray 90° around the center of the cuts. Use the 90° Splice Bar Kit (P/N 34740-X01) to secure the fitting together. One 90° Splice Bar Kit comes with enough hardware for two turns (See 90° Splice Bar Kit detail to the right).
- Use the 90° Splice Bar with Splice Washers and Bolts to connect the inside side edges together. Use the Clamp Washers and Carriage Bolt to clamp the over lapping mesh together (See image below).
- Always install bolt heads on the inside of the tray to protect cables.
- Electrical bonding of painted trays and connectors requires metal-to-metal contact between tray wires and the splice. Remove paint where the splices contact the tray and 90° Splice Bar.
- Installing a ground conductor along fitting using P/N 34838-001 is required to insure bonding across removed sections (See page 8 for details).
- Cable tray employing these splice methods is suitable for use as an equipment grounding conductor.

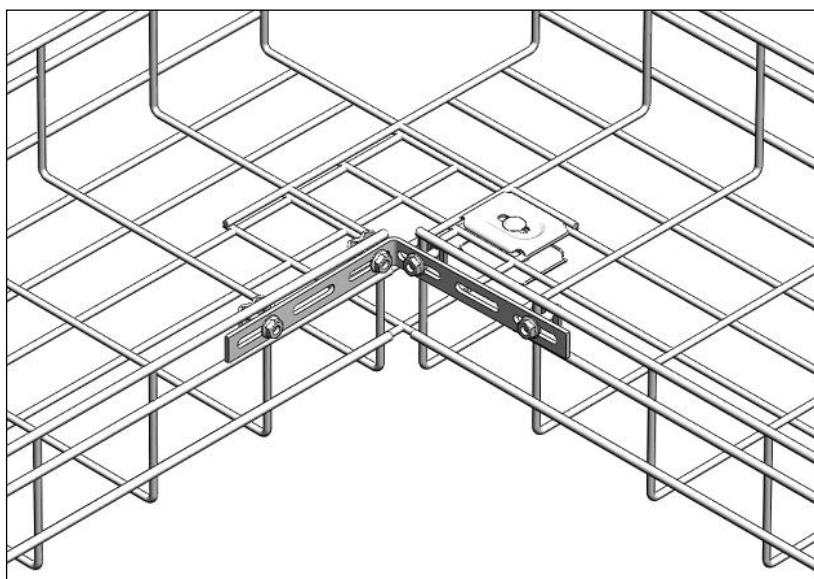

**2"H x 12"W bent and spliced tray**

**P/N 34740-X01: 90° Splice Bar Kit**


**P/N 34738-X01: Standard Splice**

Tray Width	Removed Mid-Sections	Removed Side Sections
4" 100 mm	1	3
6" 150 mm	1	5
8" 200 mm	2	4
12" 300 mm	2	6
16"	2	8

# Installation Instructions

## OnTrac Cable Tray

### Tight 90° Turn Cut Detail: Top View (2"H x 12"W Tray Shown)

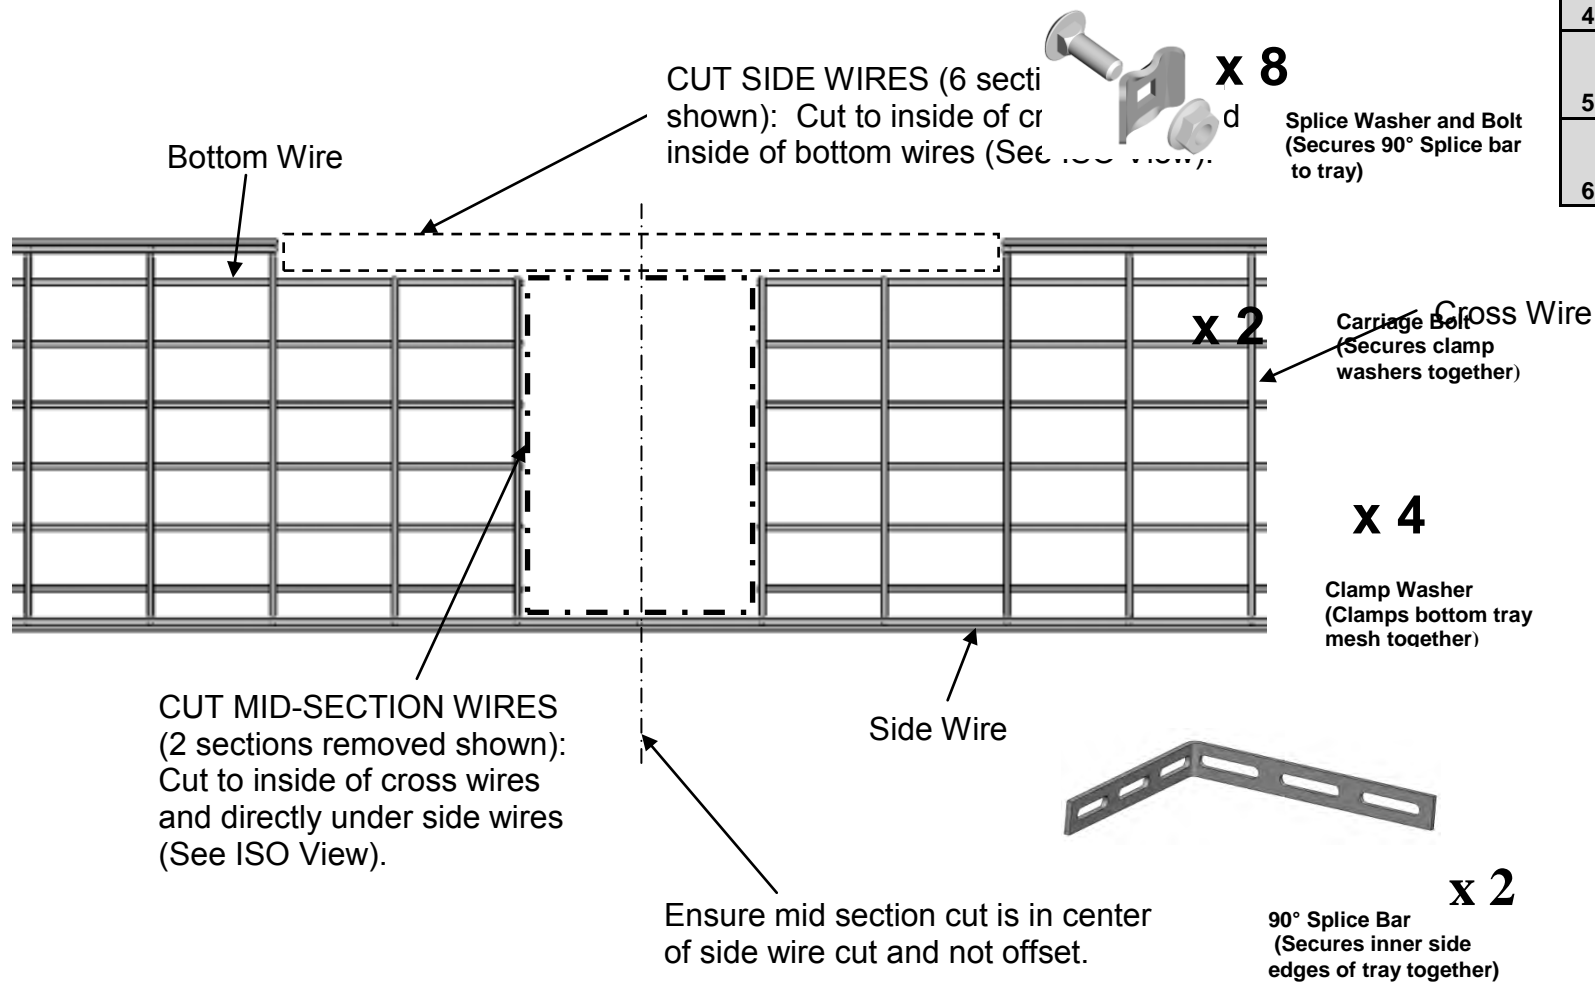

400 mm		
18"	2	8
450 mm		
20"	2	10
500 mm		
24"	2	10
600 mm		


# Installation Instructions

## OnTrac Cable Tray


### T-Intersections and Crosses

- Insure that the side wire cuts are wider than the width of the intersecting tray (See Continuous Tray cutting detail below).
- Use the 90° Splice Bar Kit (P/N 34740-X01) to secure the fitting together. One 90° Splice Bar Kit comes with enough hardware for one T fitting; you will need two kits for a tray cross over.
- To create a cross over, duplicate the T-fitting on the opposite side of the continuous tray.
- For extra strength you may cut the side wires from the tip of the intersecting tray and clamp the extra length to the bottom of the continuous tray. Clamp the mesh using clamp washers and carriage bolts; included in 90° Splice Bar Kit (See Terminating Tray images on bottom right for detail).
- Always install bolt heads on the inside of the tray to protect cables.
- Bonding of painted trays and connectors requires metal-to-metal contact between tray wires and the splice. Remove paint where the splices contact the tray and 90° splice bar.
- Installing a ground conductor along fitting using P/N 34838-001 is required to insure bonding across removed sections (See page 8 for details).
- The cable tray employing these splice methods is suitable for use as an equipment grounding conductor.

### Terminating Tray


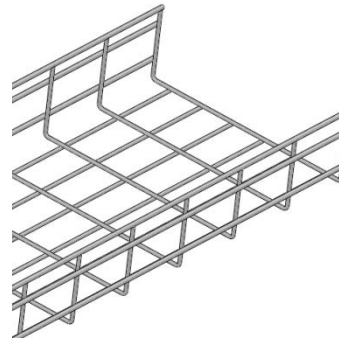


### Continuous Tray

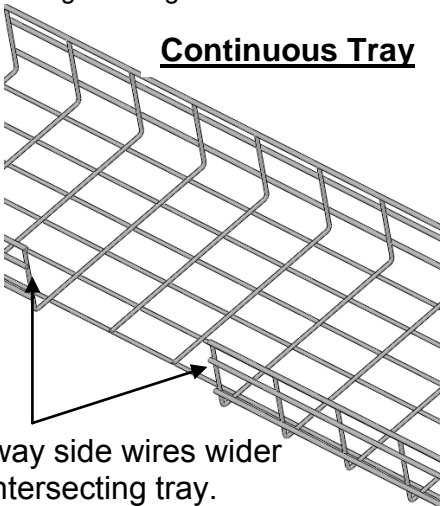

Cut away side wires wider than intersecting tray.

### Terminating Tray (Cut for clamp washers)

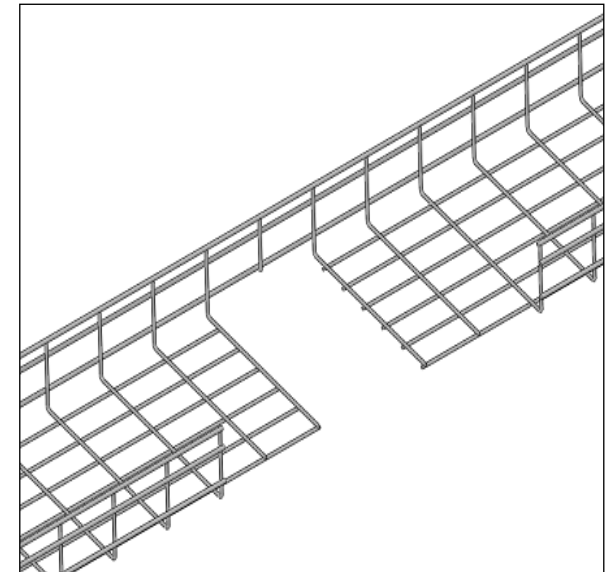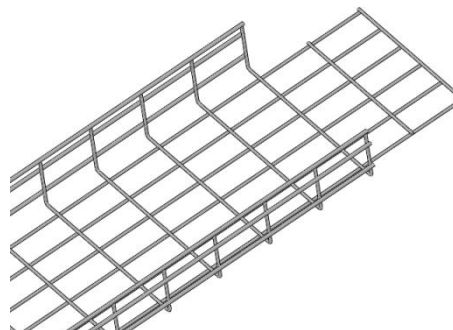

### ISO View

### T-Intersection




# Installation Instructions




## OnTrac Cable Tray

### Best Practice Tray Support

- Locate supports adjacent to each splice so that the support is positioned close to the splice, within one mesh (4") and one quarter of the length of the support span. (See image below)
- If the splice joint does not lie between the support and quarter point, the tray will not support the rated load capacities.
- A support must be used between every splice. The support span should not be more than the straight section tray length to ensure no more than one splice is located between any two supports.
- Never place the splice point of the tray directly on the support.

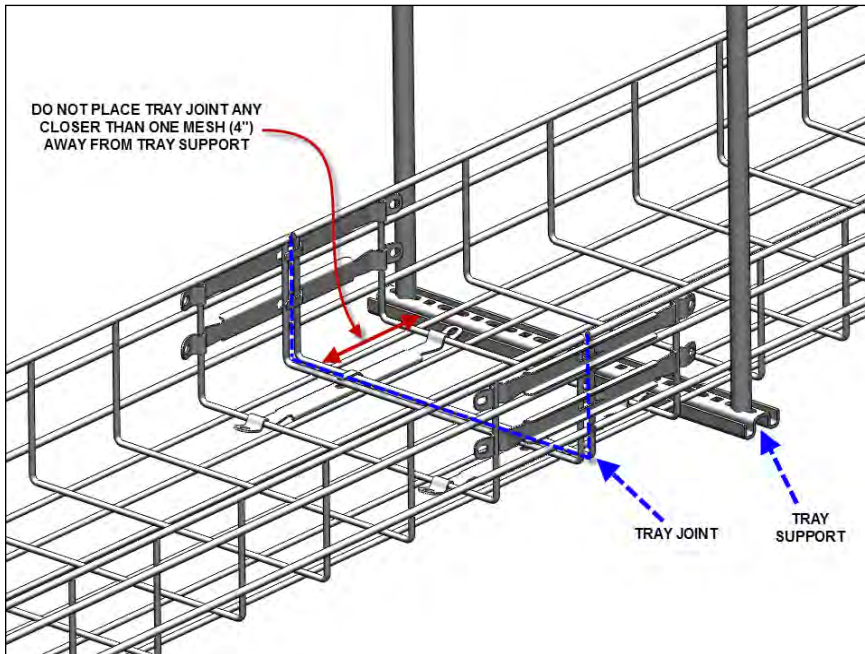

### Proper Splice Locations

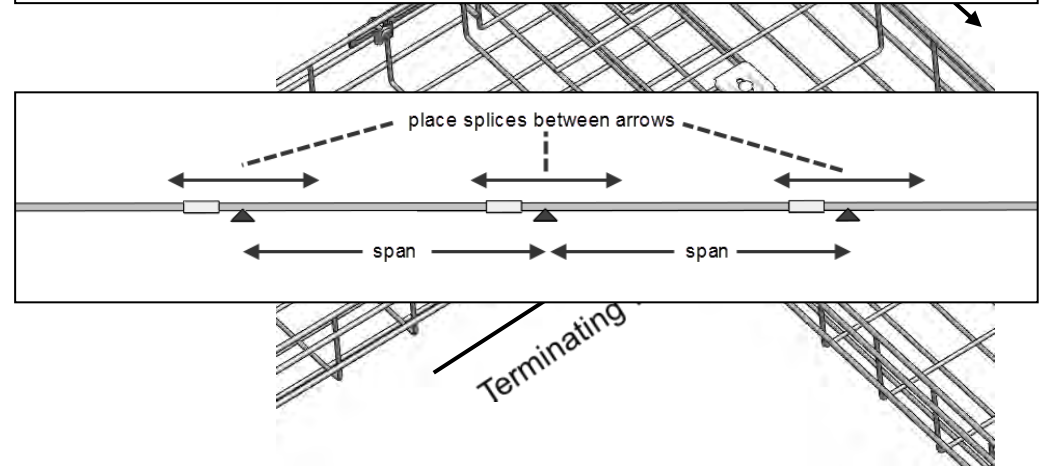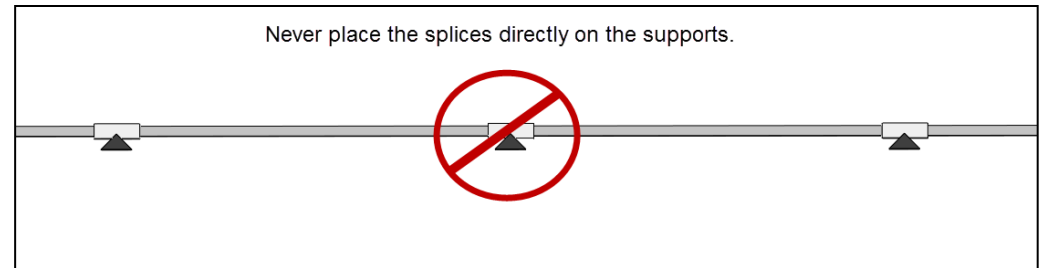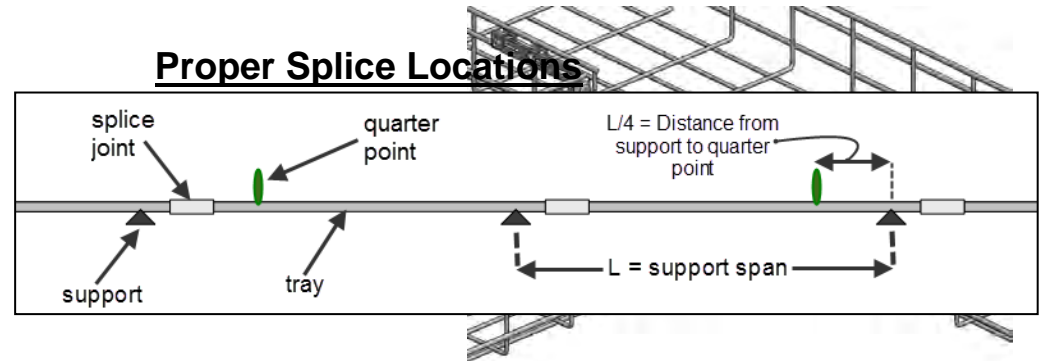

# **Installation Instructions**

## **OnTrac Cable Tray**