

# MultiFiber™ Pro

## Optical Power Meter and Fiber Test Kits

Data centers are growing, fueled by the proliferation of media, virtualization and the need for more security and storage.

This creates a high demand for 40 Gbps+ fiber links. Whether it is using 10 Gbps pre-terminated fiber trunks or planning for next-generation 40/100 Gbps performance, data centers are standardizing on Multi-fiber Push-on (MPO) connector solutions.

Pre-terminated fiber cables are manufactured and tested to comply with ANSI/TIA and international standards. When these cables are installed many factors can potentially impact performance. Field testing is the only way to ensure that pre-terminated fiber is installed to meet the application performance requirements. With single and duplex testers this verification testing is a time-consuming, manual and imprecise process. To ensure installation is done to standards, test with the MultiFiber Pro.

MultiFiber Pro takes the complexity out of testing MPO trunks for loss and polarity. With an on-board MPO connector, it is the first tester to automate the MPO fiber-trunk testing process without using a fan-out cord. The power meter/light source boasts industry-first functions such as automatic scanning of all twelve fibers and display of test results in an easy-to-read bar graph. These innovative features allow MultiFiber Pro kits to eliminate the complexity of testing MPO trunks, making it 90 percent faster than the traditional simplex test methods.





- Automatic scanning and testing of all fibers in MPO connectors with "Scan All" function
- Ensures correct end-to-end connectivity of MPO fiber trunks with built-in polarity verification
- On-board MPO connector eliminates the need for fan-out cords when testing fiber trunks
- Easy to interpret test results with minimal navigation the user interface displays all 12 fibers
- Troubleshoot MPO links and drill down to single fiber test results
- No dust caps to manage or lose with a shuttered MPO connector







## **MultiFiber Pro Unique Capabilities**

#### "SCAN ALL" Function


Scan All function in the MultiFiber Pro Power Meter automatically scans and tests all 12 fibers in MPO connectors – taking just 6 seconds to complete all loss or power measurements. This feature automates the testing of MPO terminated fibers and eliminates the time consuming and manual process of moving the tester from fiber to fiber while using fan-out cords.

#### **Built-in Polarity Verification**

The simple purpose of any polarity scheme is to provide a continuous connection from the link's transmitter to the link's receiver. For array connectors, TIA-568-C.0 defines three methods to accomplish this. Deployment mistakes are common because these methods require a combination of patch cords with different polarity types. The polarity measurement of MultiFiber Pro allows the user to test individual patch cords, permanent links, and channels for correct polarity.

#### **On-board MPO connector**

The MPO connector on both the Optical Power Meter and Light Source eliminates the use of costly and complicated fan-out cords to test MPO fiber trunks.

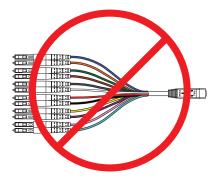

#### **Simple User Interface**

The MultiFiber Pro simplifies the task of simultaneously presenting polarity, power, and loss results for 12 fibers. The power meter enables the users to easily comprehend the measurement results of 12 fibers simultaneously. The light source identifies each fiber within the MPO connector being tested. Any individual measurements that fail the test limit is identified to allow root-cause analysis. This powerful yet straightforward test set enables everyone to become a fiber testing expert increasing efficiency in testing data center projects.

#### Select an Individual Fiber

Drilling down to a single fiber during testing and troubleshooting is always a challenge in data centers. MuliFiber Pro can troubleshoot a single fiber within an MPO trunk to provide a single fiber test result. This increases MPO connector verification and troubleshooting flexibility with more precise, per-fiber data and reporting.

#### **On-board Shuttered MPO Connector**

Uncovered ports can put cabling, equipment and testers at risk for contamination and affect performance. Ensuring a covered connection on your tester can protect it from dirt and dust. MultiFiber Pro makes it easy by shuttering the MPO connector for greater test reliability and peace of mind.

#### **Easy Reporting**

The MultiFiber Pro Power Meter stores up to 3,000 test results internally which can be uploaded to a PC using the LinkWare™ 7 Cable Test Management Software. LinkWare 7 allows you to manage test results, edit cable ID's, print professional reports and even export the data into spreadsheet formats.



#### **Kits for Every Need**

MultiFiber Pro is available in several convenient kit configurations to meet all your cleaning, inspection and verification testing needs. Some kits include:

#### • Fiber Inspection – FiberInspector™ Pro

The FiberInspector Pro is the ultimate inspection tool. Its 3.5" screen provides a larger image from its dual magnification probe. The small probe fits in the palm of your hand and can be switched between 250x and 400x magnification with the turn of a dial. The FiberInspector Pro and optional MPO tip complement the MultiFiber Pro test set, provide a comprehensive kit for cleaning, inspection and testing of MPO connected fibers and cassettes.



• Fiber Cleaning – IBC™ OneClick Cleaners

Cleaning is critical. Fluke Networks' OneClick
Cleaners instantly clean fiber optic bulkhead
connectors and end-faces. Just push the tool
tip to engage cleaning action and pull back on the
wheel – it's that simple. The MPO OneClick Cleaner is
bundled with the MultiFiber Pro kits to ensure that you
have the best cleaning tool from the beginning.





#### **General Specifications**

Environmental	
Operating temperature	-10°C to +50°C
Storage temperature	-20°C to +50°C
	95% (10°C to +35°C) non-condensing
Operating humidity	75% (35°C to +45°C) non-condensing
	Uncontrolled <10°C
Operating altitude	4,000 m
Storage altitude	12,000 m
Vibration	Random 2 G, 5 Hz to 500 Hz

Optical Power Meter (Specifications apply at 23°C (73°F), unless otherwise noted.)           Detector type         InGaAs           Calibrated wavelengths         850 nm, 1300 nm, 1310 nm, 1550 nm           Measurement range         0 dBm to -50 dBm           Power measurement linearity         ±0.1 dB¹           Power measurement uncertainty         ±0.35 dB           Power measurement repeatability         < 0.10 dB           Display resolution, dB or dBm         0.01           Power display units         dBm, mW, μW           User-selectable limit for loss         dBm, mW, μW           User-selectable limit for loss         Detects A, B, C, and Corning Plug & Play™           Polarity detection         Petects A, B, C, and Corning Plug & Play™           Universal Systems polarities         Yes           Record storage         3000 records, one fiber per record (250 12-fiber cables)           External interface         USB 2.0, full speed           MPO interface for 12-fiber, unpinned plugs. Compatible with 62.5 μm, 50 μm, and singlemode fibers. Connector has a self-closing, protective cover.           Power requirement         2 AA alkaline batteries           Battery life²         >30 hours (typical)           Automatic power-off         10, 20, 30, or 60 minutes (can be disabled by the user)           Low battery warning         Low batter	Ontical Power Mater (Specifications a	nnly at 2200 (720E) unless atherwise nated
Calibrated wavelengths  850 nm, 1300 nm, 1310 nm, 1550 nm  Measurement range  O dBm to -50 dBm  Power measurement linearity  ±0.1 dB¹  Power measurement repeatability  Power display units  User-selectable limit for loss  Auto wavelength detection  Polarity detection  Polarity detection  Record storage  External interface  Optical connector  Power requirement  2 AA alkaline batteries  Battery life²  Automatic power-off  Low battery warning  Size  Sound dBm  2 dBm  2 0.10 dB  3 0.01  4 0.05 dB to 50.0 dB, in increments of 0.05 dB up to 10.0 dB and 0.1 dB up to 50.0 dB  4 up to 10.0 dB  5 0.0 dB  4 up to 10.0 dB  5 0.0 dB  4 up to 10.0 dB  5 0.0 dB  4 up to 10.0 dB  6 0.0 dB  6 0.		
Measurement range       0 dBm to -50 dBm         Power measurement linearity       ±0.1 dB¹         Power measurement uncertainty       ±0.35 dB         Power measurement repeatability       < 0.10 dB         Display resolution, dB or dBm       0.01         Power display units       dBm, mW, μW         User-selectable limit for loss       0.05 dB to 50.0 dB, in increments of 0.05 dB up to 10.0 dB and 0.1 dB up to 50.0 dB         Auto wavelength detection       Yes         Polarity detection       Detects A, B, C, and Corning Plug & Play™ Universal Systems polarities         2 kHz detection       Yes         Record storage       3000 records, one fiber per record (250 12-fiber cables)         External interface       USB 2.0, full speed         MPO interface for 12-fiber, unpinned plugs. Compatible with 62.5 μm, 50 μm, and singlemode fibers. Connector has a self-closing, protective cover.         Power requirement       2 AA alkaline batteries         Battery life²       >30 hours (typical)         Automatic power-off       10, 20, 30, or 60 minutes (can be disabled by the user)         Low battery warning       Low battery icon blinks         Size       5.7 in x 3.2 in x 1.5 in (14.5 cm x 8.0 cm x 3.9 cm)		
Power measurement linearity       ±0.1 dB¹         Power measurement uncertainty       ±0.35 dB         Power measurement repeatability       < 0.10 dB         Display resolution, dB or dBm       0.01         Power display units       dBm, mW, μW         User-selectable limit for loss       0.05 dB to 50.0 dB, in increments of 0.05 dB up to 10.0 dB and 0.1 dB up to 50.0 dB         Auto wavelength detection       Yes         Polarity detection       Detects A, B, C, and Corning Plug & Play™ Universal Systems polarities         2 kHz detection       Yes         Record storage       3000 records, one fiber per record (250 12-fiber cables)         External interface       USB 2.0, full speed         MPO interface for 12-fiber, unpinned plugs. Compatible with 62.5 μm, 50 μm, and singlemode fibers. Connector has a self-closing, protective cover.         Power requirement       2 AA alkaline batteries         Battery life²       >30 hours (typical)         Automatic power-off       10, 20, 30, or 60 minutes (can be disabled by the user)         Low battery warning       Low battery icon blinks         Size       5.7 in x 3.2 in x 1.5 in (14.5 cm x 8.0 cm x 3.9 cm)		
Power measurement uncertainty ±0.35 dB  Power measurement repeatability < 0.10 dB  Display resolution, dB or dBm 0.01  Power display units dBm, mW, μW  User-selectable limit for loss dB up to 10.0 dB and 0.1 dB up to 50.0 dB  Auto wavelength detection Yes  Polarity detection Yes  2 kHz detection Yes  Record storage 3000 records, one fiber per record (250 12-fiber cables)  External interface USB 2.0, full speed  MPO interface for 12-fiber, unpinned plugs. Compatible with 62.5 μm, 50 μm, and singlemode fibers. Connector has a self-closing, protective cover.  Power requirement 2 AA alkaline batteries  Battery life² >30 hours (typical)  Automatic power-off 10, 20, 30, or 60 minutes (can be disabled by the user)  Low battery warning Low battery icon blinks  5.7 in x 3.2 in x 1.5 in (14.5 cm x 8.0 cm x 3.9 cm)		
Power measurement repeatability       < 0.10 dB         Display resolution, dB or dBm       0.01         Power display units       dBm, mW, μW         User-selectable limit for loss       0.05 dB to 50.0 dB, in increments of 0.05 dB up to 10.0 dB and 0.1 dB up to 50.0 dB         Auto wavelength detection       Yes         Polarity detection       Detects A, B, C, and Corning Plug & Play™ Universal Systems polarities         2 kHz detection       Yes         Record storage       3000 records, one fiber per record (250 12-fiber cables)         External interface       USB 2.0, full speed         MPO interface for 12-fiber, unpinned plugs. Compatible with 62.5 μm, 50 μm, and singlemode fibers. Connector has a self-closing, protective cover.         Power requirement       2 AA alkaline batteries         Battery life²       >30 hours (typical)         Automatic power-off       10, 20, 30, or 60 minutes (can be disabled by the user)         Low battery warning       Low battery icon blinks         Size       5.7 in x 3.2 in x 1.5 in (14.5 cm x 8.0 cm x 3.9 cm)	,	
Display resolution, dB or dBm       0.01         Power display units       dBm, mW, μW         User-selectable limit for loss       0.05 dB to 50.0 dB, in increments of 0.05 dB up to 10.0 dB and 0.1 dB up to 50.0 dB         Auto wavelength detection       Yes         Polarity detection       Detects A, B, C, and Corning Plug & Play™ Universal Systems polarities         2 kHz detection       Yes         Record storage       3000 records, one fiber per record (250 12-fiber cables)         External interface       USB 2.0, full speed         MPO interface for 12-fiber, unpinned plugs. Compatible with 62.5 μm, 50 μm, and singlemode fibers. Connector has a self-closing, protective cover.         Power requirement       2 AA alkaline batteries         Battery life²       >30 hours (typical)         Automatic power-off       10, 20, 30, or 60 minutes (can be disabled by the user)         Low battery warning       Low battery icon blinks         Size       5.7 in x 3.2 in x 1.5 in (14.5 cm x 8.0 cm x 3.9 cm)	,	
Power display units       dBm, mW, μW         User-selectable limit for loss       0.05 dB to 50.0 dB, in increments of 0.05 dB up to 10.0 dB and 0.1 dB up to 50.0 dB         Auto wavelength detection       Yes         Polarity detection       Detects A, B, C, and Corning Plug & Play™ Universal Systems polarities         2 kHz detection       Yes         Record storage       3000 records, one fiber per record (250 12-fiber cables)         External interface       USB 2.0, full speed         MPO interface for 12-fiber, unpinned plugs. Compatible with 62.5 μm, 50 μm, and singlemode fibers. Connector has a self-closing, protective cover.         Power requirement       2 AA alkaline batteries         Battery life²       >30 hours (typical)         Automatic power-off       10, 20, 30, or 60 minutes (can be disabled by the user)         Low battery warning       Low battery icon blinks         Size       5.7 in x 3.2 in x 1.5 in (14.5 cm x 8.0 cm x 3.9 cm)		
User-selectable limit for loss  Auto wavelength detection  Polarity detection  Record storage  Optical connector  Power requirement  Battery life²  Automatic power-off  Low battery warning  Optical connector  Optical connector  Optical connector  Detects A, B, C, and Corning Plug & Play™ Universal Systems polarities  Yes  3000 records, one fiber per record (250 12-fiber cables)  WPO interface for 12-fiber, unpinned plugs. Compatible with 62.5 μm, 50 μm, and singlemode fibers. Connector has a self-closing, protective cover.  Power requirement  Detects A, B, C, and Corning Plug & Play™ Universal Systems polarities  Yes  3000 records, one fiber per record (250 12-fiber cables)  Low batteries  All all appears and self-closing, protective cover.  Power requirement  Detects A, B, C, and Corning Plug & Play™ Universal Systems polarities  Yes  4000 records, one fiber per record (250 12-fiber cables)  Low patteriates  Appears and Systems polarities  10, 20, 40, full speed  10, 20, 30, or 60 minutes (can be disabled by the user)  Low battery warning  Low battery icon blinks  5.7 in x 3.2 in x 1.5 in (14.5 cm x 8.0 cm x 3.9 cm)	, ,	
User-selectable limit for loss       dB up to 10.0 dB and 0.1 dB up to 50.0 dB         Auto wavelength detection       Yes         Polarity detection       Detects A, B, C, and Corning Plug & Play™ Universal Systems polarities         2 kHz detection       Yes         Record storage       3000 records, one fiber per record (250 12-fiber cables)         External interface       USB 2.0, full speed         MPO interface for 12-fiber, unpinned plugs. Compatible with 62.5 μm, 50 μm, and singlemode fibers. Connector has a self-closing, protective cover.         Power requirement       2 AA alkaline batteries         Battery life²       >30 hours (typical)         Automatic power-off       10, 20, 30, or 60 minutes (can be disabled by the user)         Low battery warning       Low battery icon blinks         Size       5.7 in x 3.2 in x 1.5 in (14.5 cm x 8.0 cm x 3.9 cm)	Power display units	dBm, mW, μW
Polarity detection       Detects A, B, C, and Corning Plug & Play™ Universal Systems polarities         2 kHz detection       Yes         Record storage       3000 records, one fiber per record (250 12-fiber cables)         External interface       USB 2.0, full speed         MP0 interface for 12-fiber, unpinned plugs. Compatible with 62.5 μm, 50 μm, and singlemode fibers. Connector has a self-closing, protective cover.         Power requirement       2 AA alkaline batteries         Battery life²       >30 hours (typical)         Automatic power-off       10, 20, 30, or 60 minutes (can be disabled by the user)         Low battery warning       Low battery icon blinks         Size       5.7 in x 3.2 in x 1.5 in (14.5 cm x 8.0 cm x 3.9 cm)	User-selectable limit for loss	
Polarity detection       Universal Systems polarities         2 kHz detection       Yes         Record storage       3000 records, one fiber per record (250 12-fiber cables)         External interface       USB 2.0, full speed         MPO interface for 12-fiber, unpinned plugs. Compatible with 62.5 μm, 50 μm, and singlemode fibers. Connector has a self-closing, protective cover.         Power requirement       2 AA alkaline batteries         Battery life²       >30 hours (typical)         Automatic power-off       10, 20, 30, or 60 minutes (can be disabled by the user)         Low battery warning       Low battery icon blinks         Size       5.7 in x 3.2 in x 1.5 in (14.5 cm x 8.0 cm x 3.9 cm)	Auto wavelength detection	Yes
Record storage       3000 records, one fiber per record (250 12-fiber cables)         External interface       USB 2.0, full speed         MPO interface for 12-fiber, unpinned plugs. Compatible with 62.5 μm, 50 μm, and singlemode fibers. Connector has a self-closing, protective cover.         Power requirement       2 AA alkaline batteries         Battery life²       >30 hours (typical)         Automatic power-off       10, 20, 30, or 60 minutes (can be disabled by the user)         Low battery warning       Low battery icon blinks         Size       5.7 in x 3.2 in x 1.5 in (14.5 cm x 8.0 cm x 3.9 cm)	Polarity detection	
Record storage         External interface         USB 2.0, full speed         MP0 interface for 12-fiber, unpinned plugs. Compatible with 62.5 μm, 50 μm, and singlemode fibers. Connector has a self-closing, protective cover.         Power requirement       2 AA alkaline batteries         Battery life²       >30 hours (typical)         Automatic power-off       10, 20, 30, or 60 minutes (can be disabled by the user)         Low battery warning       Low battery icon blinks         Size       5.7 in x 3.2 in x 1.5 in (14.5 cm x 8.0 cm x 3.9 cm)	2 kHz detection	Yes
Optical connector       MPO interface for 12-fiber, unpinned plugs. Compatible with 62.5 μm, 50 μm, and singlemode fibers. Connector has a self-closing, protective cover.         Power requirement       2 AA alkaline batteries         Battery life²       >30 hours (typical)         Automatic power-off       10, 20, 30, or 60 minutes (can be disabled by the user)         Low battery warning       Low battery icon blinks         Size       5.7 in x 3.2 in x 1.5 in (14.5 cm x 8.0 cm x 3.9 cm)	Record storage	
Optical connector       Compatible with 62.5 μm, 50 μm, and singlemode fibers. Connector has a self-closing, protective cover.         Power requirement       2 AA alkaline batteries         Battery life²       >30 hours (typical)         Automatic power-off       10, 20, 30, or 60 minutes (can be disabled by the user)         Low battery warning       Low battery icon blinks         Size       5.7 in x 3.2 in x 1.5 in (14.5 cm x 8.0 cm x 3.9 cm)	External interface	USB 2.0, full speed
Battery life <sup>2</sup> >30 hours (typical)  Automatic power-off 10, 20, 30, or 60 minutes (can be disabled by the user)  Low battery warning Low battery icon blinks  Size 5.7 in x 3.2 in x 1.5 in (14.5 cm x 8.0 cm x 3.9 cm)	Ontigal connector	
Automatic power-off  10, 20, 30, or 60 minutes (can be disabled by the user)  Low battery warning  Low battery icon blinks  5.7 in x 3.2 in x 1.5 in (14.5 cm x 8.0 cm x 3.9 cm)	optical connector	3
Automatic power-off (can be disabled by the user)  Low battery warning Low battery icon blinks  5.7 in x 3.2 in x 1.5 in (14.5 cm x 8.0 cm x 3.9 cm)	,	self-closing, protective cover.
5.7 in x 3.2 in x 1.5 in (14.5 cm x 8.0 cm x 3.9 cm)	Power requirement	self-closing, protective cover.  2 AA alkaline batteries
(14.5 cm x 8.0 cm x 3.9 cm)	Power requirement  Battery life <sup>2</sup>	self-closing, protective cover.  2 AA alkaline batteries  >30 hours (typical)  10, 20, 30, or 60 minutes
<b>Weight</b> 10.9 oz (309 g)	Power requirement  Battery life <sup>2</sup> Automatic power-off	self-closing, protective cover.  2 AA alkaline batteries  >30 hours (typical)  10, 20, 30, or 60 minutes (can be disabled by the user)
	Power requirement  Battery life <sup>2</sup> Automatic power-off  Low battery warning	self-closing, protective cover.  2 AA alkaline batteries  >30 hours (typical)  10, 20, 30, or 60 minutes (can be disabled by the user)  Low battery icon blinks  5.7 in x 3.2 in x 1.5 in

- For 850 nm, 0 dBm to -50 dBm. For 1300, 1310, 1550 nm, -5 dBm to -50 dBm
   Measured power levels ≤0 dBm. Backlight on. Battery life depends on the condition and type of batteries used. Fluke Networks recommends alkaline batteries
   23°C ±2°C, after 10 minutes of warm-up time.
- 4. Auto wavelength, SCAN ALL, and backlight on. Battery life depends on the condition and type of batteries used. Fluke Networks recommends alkaline batteries.

#### **General Specifications**

<b>850nm Source</b> (Specifications apply at 23°C (73°F), unless otherwise noted)		
Emitter type	LED: 850 nm	
Wavelength	850 nm: ±30 nm	
Spectral width (FWHM)	850 nm: +/- 50 nm (typical)	
Output power	850 nm: ≥24 dBm. Max difference between channels +/-1dB	
Power output stability <sup>3</sup>	≤ ±0.1 dB over 8 hours	
Encircled flux	Meets ANSI/TIA-526-14-B, ISO/IEC 14763-3, and IEC 61280-4-1 for 50/125 μm at the source's optical connector.	
Optical connector	MPO interface for 12-fiber, unpinned plugs. Compatible with 62.5 μm and 50 μm.	
Modes	2 kHz modulated, auto wavelength	
Power requirement	2 AA alkaline batteries	
Battery life <sup>4</sup>	>30 hours (typical)	
Automatic power-off	10, 20, 30, or 60 minutes (can be disabled by the user)	
Low battery warning	Low battery icon blinks	
Size	5.6 in x 3.2 in x 1.6 in (14.2 cm x 8.1 cm x 4.1 cm)	
Weight	10.9 oz (309 g)	







#### **MultiFiber™ Pro Ordering Information**

Model	Description
MFTK1200	MultiFiber Pro Testing Base Kit includes MultiFiber Pro Power Meter, 850 light source, test cords, MPO adapters, MPO OneClick Cleaner, and carrying case
MFTK1400	MultiFiber Pro Testing and Inspection Kit includes MFTK1200, FT600 FiberInspector Pro with NF370 MPO tip
MFPOWERMETER	MultiFiber Pro Optical Power Meter
MFMULTIMODESOURCE	MultiFiber Pro Mulitmode 850 nm LED light source
FT600	FiberInspector Pro
NF370	MPO Fiber Inspection Adapter Tip for FT600
TRC-MPO-PP-B	1 m test cord with MPO/MPO, Pinned/Pinned, Type B polarity
TRC-MPO-UP-B	1 m test cord with MPO/MPO, Unpinned/Pinned, Type B polarity
TRC-MPO-UU-B	0.3 m test cord with MPO/MPO, Unpinned/Unpinned, Type B polarity
BKC-MPO-ULC	1 m breakout cord for MPO Unpinned LC connector
BKC-MPO-USC	1 m breakout cord for MPO Unpinned SC connector
ADP-MPO-B	Type B polarity MPO adapter
GLD-MF	1 YR GOLD for MFPOWERMETER/MFMULTIMODESOURCE
GLD-MFTK	1 YR GOLD for MFTK1200, MFTK1400
NFC-IBC-1.25mm	OneClick cleaners for 1.25 mm LC and MU connector and patch cord (5 qty)
NFC-IBC-2.5mm	OneClick cleaners for 2.5 mm SC, ST, FC connectors and patch cord (5 qty)
NFC-IBC-MPO	OneClick cleaners for MPO connector (5 qty)
NFC-KIT-CASE-E	Enhanced Fiber Optic Cleaning Kit – includes (1) OneClick cleaner for 1.25mm connectors, (1) OneClick cleaner for 2.5mm connectors, (1) OneClick cleaner for MPO connectors, a solvent pen, a cleaning cube and a soft case

#### **Model Kit Contents**

Model	Description	
OFPQI-MFP	Data Center Fiber (MM/SM) Troubleshooting Kit - OptiFiber Pro + Quad, MultiFiber Pro and MPO Inspection Tip	
OFPMI-MFP	Data Center Fiber (MM) Troubleshooting Kit - OptiFiber Pro + MM, MultiFiber Pro and MPO Inspection Tip	
OFPQI-MFP-CER	Enterprise Fiber Cabling Kit Certification and Troubleshooting Kit - OptiFiber Pro + Quad, DTX-CertiFiber, MultiFiber Pro + MPO Inspection Kit	



### Fluke Networks' Gold Support

Gold Support is a comprehensive maintenance and support membership program for those that cannot afford downtime and are most committed to maintaining their equipment to the highest standards. Gold members are entitled to a free annual calibration and factory refresh with free shipping and loaner unit, priority first-in-queue 24/7 technical assistance via members-only hotline, free firmware/software upgrades with priority notification, free accessory replacement, first-on-bench priority repair with free next-day shipping and loaner unit, plus member-only training, promotional discounts and resources.

See www.flukenetworks.com/goldsupport for more information.

Fluke Networks

P.O. Box 777, Everett, WA USA 98206-0777

Fluke Networks operates in more than 50 countries worldwide. To find your local office contact details, go to www.flukenetworks.com/contact.